6. Exploded View & Parts List

6-1 CS14Y530X/BWT

You can search for the updated part code through ITSELF web site.
URL : http://itself.sec.samsung.co.kr

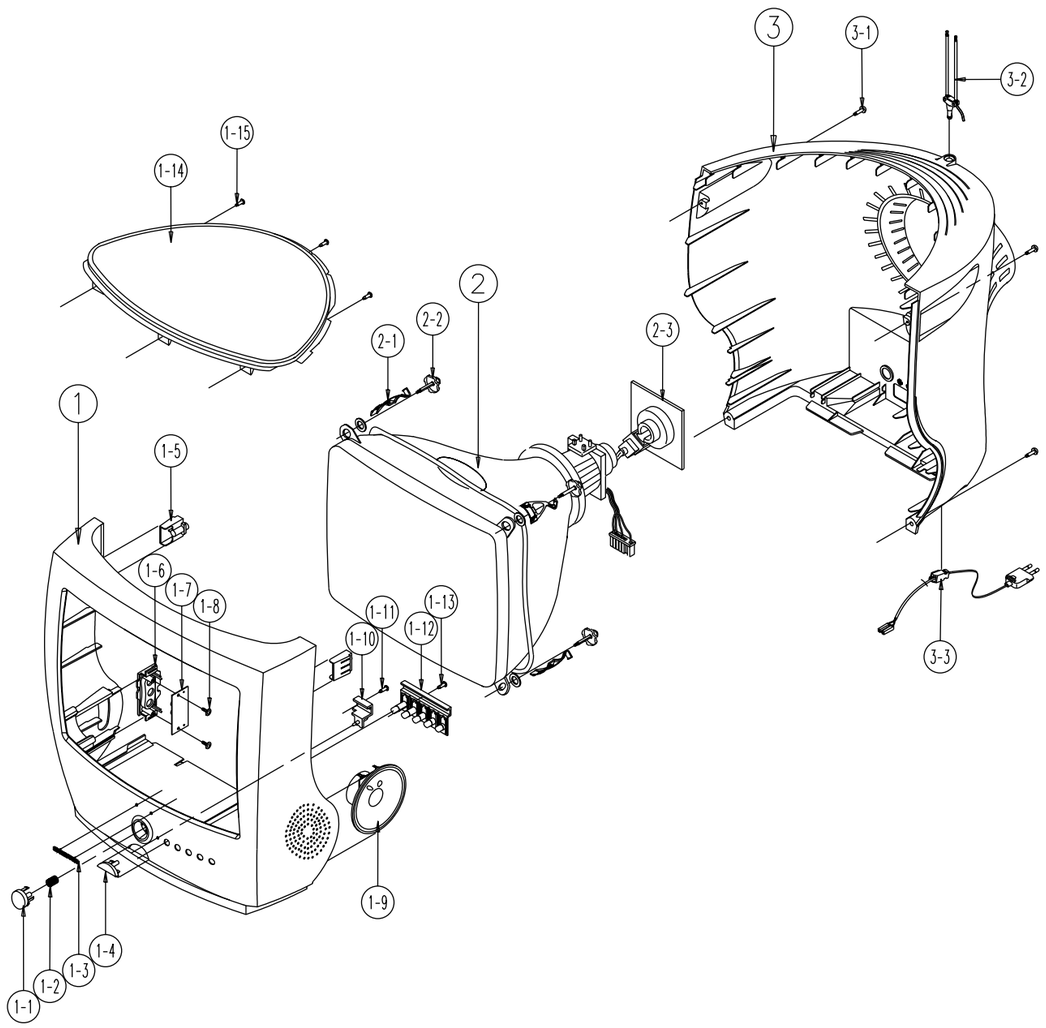

No	Code No	Description	Specification	Q'ty	Remark	S.N.A
1	AA91-00485P	ASSY CABINET FRONT;,14Y5,LB-105A CIS KS1		1	T0003	
1-1	AA64-00864B	KNOB POWER;14Y5,ABS,-,-,-,HB,G3676,-,SV-		1	T0023	
1-2	AA61-60003J	SPRING ETC-CS;-,SUS304,-,-,OD6,N7,OD6,-,		1	CIS7	S.N.A
1-3	AA64-70127F	BADGE-BRAND;NEW,AL,T1.4,6.3,L40,R800,SIL		1	T0057	S.N.A
1-4	AA64-00865B	WINDOW REMOCON;14Y5,PC,-,-,-,VO,VIOLET,-		1	T0238	S.N.A
1-5	AA61-00374C	BOSS-CABINET;14Y5,ABS,-,-,-,G3676,HB		2		S.N.A
1-6	AA61-00371L	HOLDER-AV;14Y5,ABS,-,-,-,WHT,HB,LB105A		1	T0010	S.N.A
1-7	AA95-01861C	ASSY SUB-PCB-A/V SIDE;14Y5,KS1AGREEN-CAB		1	T0329	
1-8	6003-001026	SCREW-TAPTITE;RH,+,B,M4,L15,ZPC(BLK),SWR		2	T0081	S.N.A
1-9	AA91-00493A	ASSY HOLDER SPK;-,-,2.5W/16ohm,ORG/WHI,W		1	T0010	
1-10	AA64-01180C	INDICATOR LED;14Y5,PC V0,CLEAR		1	T0059	
1-11	6003-001026	SCREW-TAPTITE;RH,+,B,M4,L15,ZPC(BLK),SWR		1	T0081	S.N.A
1-12	AA64-01179H	KNOB CONTROL;14Y5,ABS,-,-,-,HB,WHT,-,LB1		1	T0022	
1-13	6003-001019	SCREW-TAPTITE;RH,+,B,M4,L12,ZPC(BLK),SWR		1	T0081	
1-14	AA64-00867F	DECORATION-TOP;14Y5,HIPS,-,-,-,VO,G4309,		1	M0732	
2	AA03-10002M	CRT COLOR;A34KQV42X,0mG,3.20mH,30.0mH,4.		1	T0063	
2-1	AA60-10050R	SCREW-ASSY;-,SWRCH18A,M5,L31.5,HH,+,WC,-		4	SC016	S.N.A
2-2	AA65-30106A	CLAMPER CORE-D,COIL;14 INCH,NYLON 66,V2,		2	D-COIL	S.N.A
2-3	3704-000103	SOCKET-CRT;10P,22.5,14.3,SN,ISMS01S/BK		1	V999S	
3	AA64-01178C	CABINET BACK;14Y5,HIPS,-,-,-,V2,G7666,GD		1	T0015	
3-1	6003-001026	SCREW-TAPTITE;RH,+,B,M4,L15,ZPC(BLK),SWR		4	T0081	S.N.A
3-2	AA42-00003A	ANT ROD;-,3S,720mm,ABS,UL/CSA,-		1	T0075	
3-3	AA96-20109B	ASSY POWER CORD;-,CP2/NO(4.0),H/C250,KKP		1	T0066	S.N.A

6-2 CS14H40X/BWT

You can search for the updated part code through ITSELF web site.
URL : http://itself.sec.samsung.co.kr

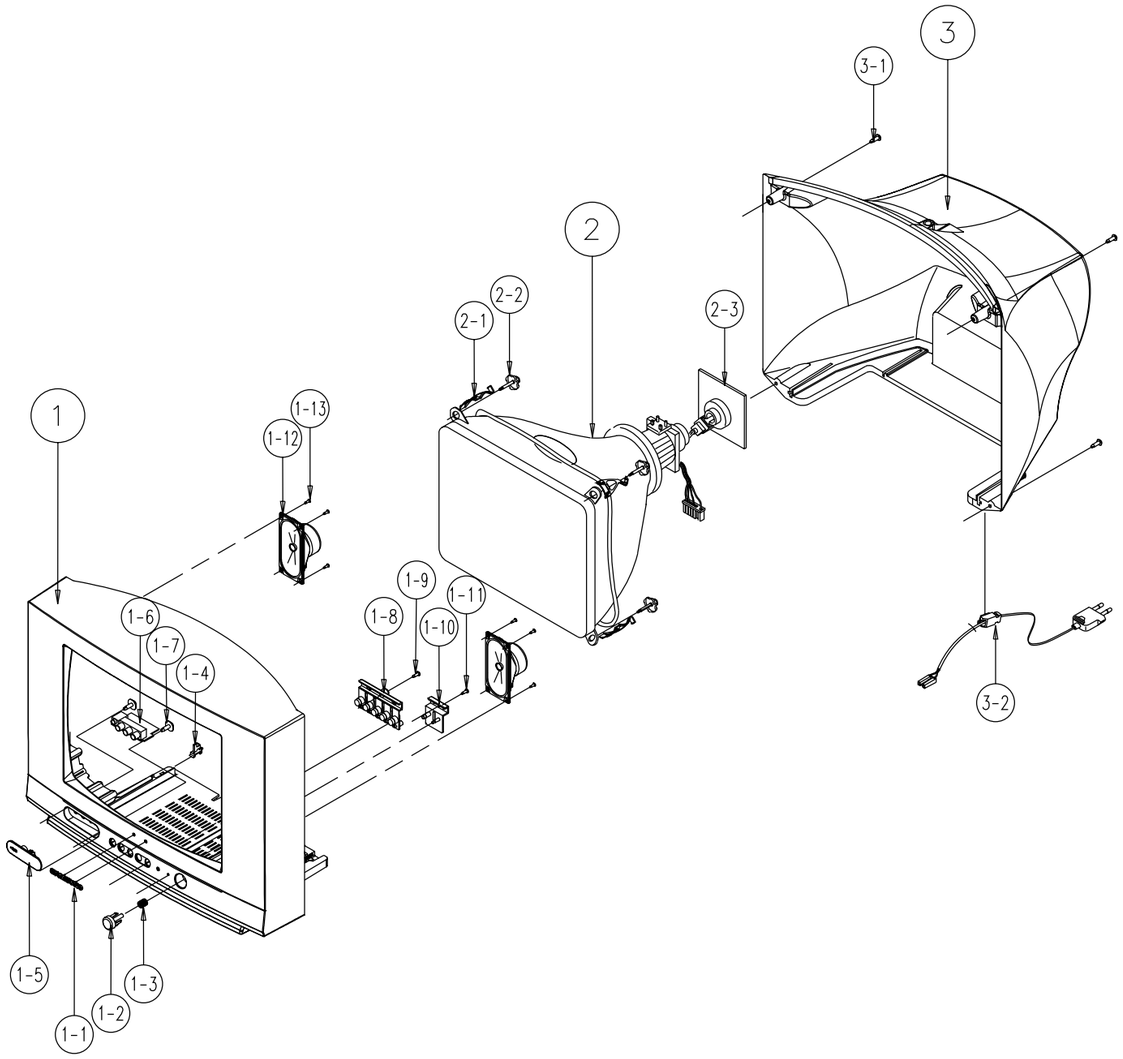

No	Code No	Description	Specification	Q'ty	Remark	S.N.A
1	AA96-00956A	ASSY COVER P-C/FRONT;14H4,HIPS HB,BLK,SP		1	T0003	
1*	AA64-02797A	CABINET-FRONT;14H4,HIPS,HB,BLK,BK708P ML		1		
1-1	AA64-70127F	BADGE-BRAND;NEW,AL,T1.4,6.3,L40,R800,SIL		1	T0057	S.N.A
1-2	AA64-02799A	KNOB-POWER;20H4,ABS,HB,BLK,NO-SILK		1	T0023	
1-3	AA61-60003J	SPRING ETC-CS;-,SUS304,-,-,OD6,N7,OD6,-,		1	CIS7	S.N.A
1-4	AA61-40113A	STOPPER-PCB;501H,HIPS,-,-,HB,NTR,-		1		S.N.A
1-6	AA95-01724A	ASSY SUB-A/V,FRONT;S4,KS1A,MONO,AA95-014		1	T0006	
1-7	6006-001095	SCREW-ASS'Y TAPT;WP,BH,+,M4,L12,ZPC(YEL)		2	AV+CF	S.N.A
1-8	AA64-02801A	KNOB-CONTROL;20H4,ABS,HB,BLK		1	T0022	
1-9	6003-001019	SCREW-TAPTITE;RH,+,B,M4,L12,ZPC(BLK),SWR		1	T0081	
1-10	AA64-02803A	WINDOW-RMC,LED;20H4,ACRYL,CLR		1	T0299	S.N.A
1-11	6003-001019	SCREW-TAPTITE;RH,+,B,M4,L12,ZPC(BLK),SWR		1	T0081	
1-12	AA96-10146C	ASSY SPEAKER;-,8ohm,5W,3001-000274,350/7		1		S.N.A
1-13	6003-001019	SCREW-TAPTITE;RH,+,B,M4,L12,ZPC(BLK),SWR		8	T0081	
2	AA03-10002M	CRT COLOR;A34KQV42X,0mG,3.20mH,30.0mH,4.		1	T0063	
2-1	AA65-30106A	CLAMPER CORE-D,COIL;14 INCH,NYLON 66,V2,		2		S.N.A
2-2	AA60-10050R	SCREW-ASSY;-,SWRCH18A,M5,L31.5,HH,+,WC,-		4	SC016	S.N.A
2-3	3704-000103	SOCKET-CRT;10P,22.5,14.3,SN,ISMS01S/BK		1	V999S	
3	AA64-01035A	CABINET BACK;14H2,H4,HIPS,V2,BLK		1	T0015	
3-1	AA60-10050T	SCREW-TAPPING;-,SWRCH18A,M4,L20,RH,+,2S,		4	T0081	S.N.A
3-2	AA96-20109B	ASSY POWER CORD;-,CP2/NO(4.0),H/C250,KKP		1	T0066	S.N.A

6-3 CS21D90X/BWT

You can search for the updated part code through ITSELF web site.
URL : http://itself.sec.samsung.co.kr

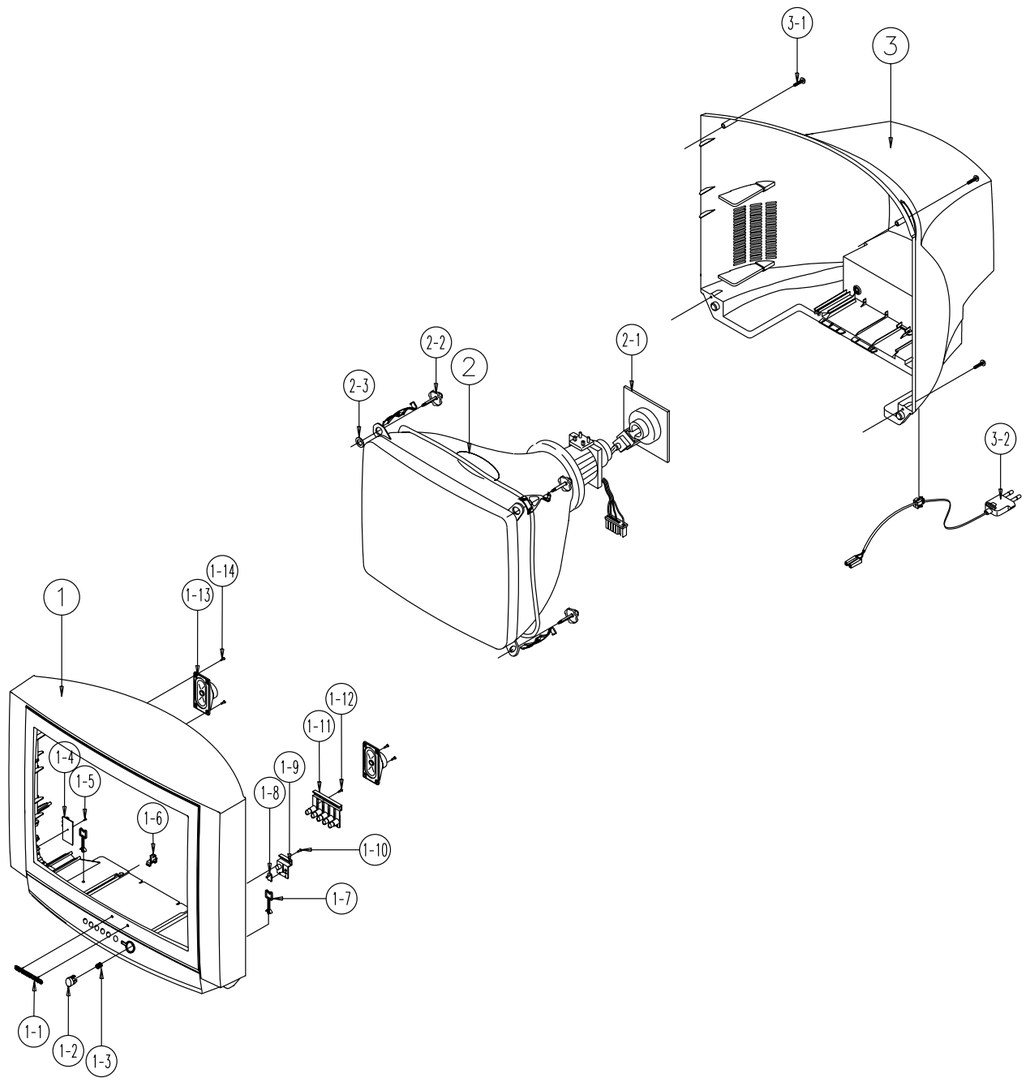

No	Code No	Description	Specification	Q'ty	Remark	S.N.A
	AA64-02159C	CABINET FRONT;CS21D9X/BWT,HIPS,HB,BK-708		1	CIS3	
1-1	AA64-70123B	BADGE-BRAND;ALL,AL,8.5,L50,BLK,SILVER,SA		1	T0057	S.N.A
1-2	AA64-03278A	KNOB POWER;CS21D9X/BWT,ABS,HB,K2901		1	T0023	
1-3	AA61-60003J	SPRING ETC-CS;-,SUS304,-,-,OD6,N7,OD6,-,		1	CIS7	S.N.A
1-4		ASSY-PCB;A/V,SIDE,K15A(H),21		1		
1-5		SCREW-TAPPING;TH,+,2,M4,L15,ZP		1	PAS+CF	
1-6	AA61-40113A	STOPPER-PCB;501H,HIPS,-,-,HB,NTR,-		1		S.N.A
1-7	AA65-30105B	CLAMPER CORE-WIRE;ALL MODEL,NYLON 66,V2,		1		S.N.A
1-8		INDICATOR LED;29D8,ACRYL,-,CLR,-,-,-		1		
1-9	AA64-02156A	WINDOW-RMC&IND;CS21D9,PC,2.0MM,V0,CLR		1	T0298	
1-10	6003-001026	SCREW-TAPTITE;RH,+,B,M4,L15,ZPC(BLK),SWR		1	T0081	S.N.A
1-11	AA64-03277A	KNOB CONTROL;CS21D9X/BWT,ABS,HB,K2901		1	T0022	
1-12	6003-001026	SCREW-TAPTITE;RH,+,B,M4,L15,ZPC(BLK),SWR		1	T0081	S.N.A
1-13	3001-000274	SPEAKER;5W,8OHM,90DB,160HZ		2	T0082	
1-14	6003-001019	SCREW-TAPTITE;RH,+,B,M4,L12,ZPC(BLK),SWR		8	T0081	
2	AA03-10024T	CRT COLOR;A51KQJ63X(H),+380mG,2.28mH,22.		1	T0063	
2-1	3704-001105	SOCKET-CRT;11P,20PI,26.5PI,NI,-		1	V999S	
2-2	AA60-10050R	SCREW-ASSY;-,SWRCH18A,M5,L31.5,HH,+,WC,-		4	SC016	S.N.A
2-3	AA65-30107A	CLAMPER CORE-D,COIL;20~22 INCH,NYLON 66,		4		S.N.A
3	AA64-01422L	CABINET BACK;CS21D9X/BWT,HIPS,V2		1	T0015	
3-1	AA60-10050T	SCREW-TAPPING;-,SWRCH18A,M4,L20,RH,+,2S,		4	T0081	S.N.A
3-2	AA96-20109B	ASSY POWER CORD;-,CP2/NO(4.0),H/C250,KKP		1	T0066	S.N.A

6-4 CS14V5MJ0X/CBM

You can search for the updated part code through ITSELF web site.
URL : http://itself.sec.samsung.co.kr

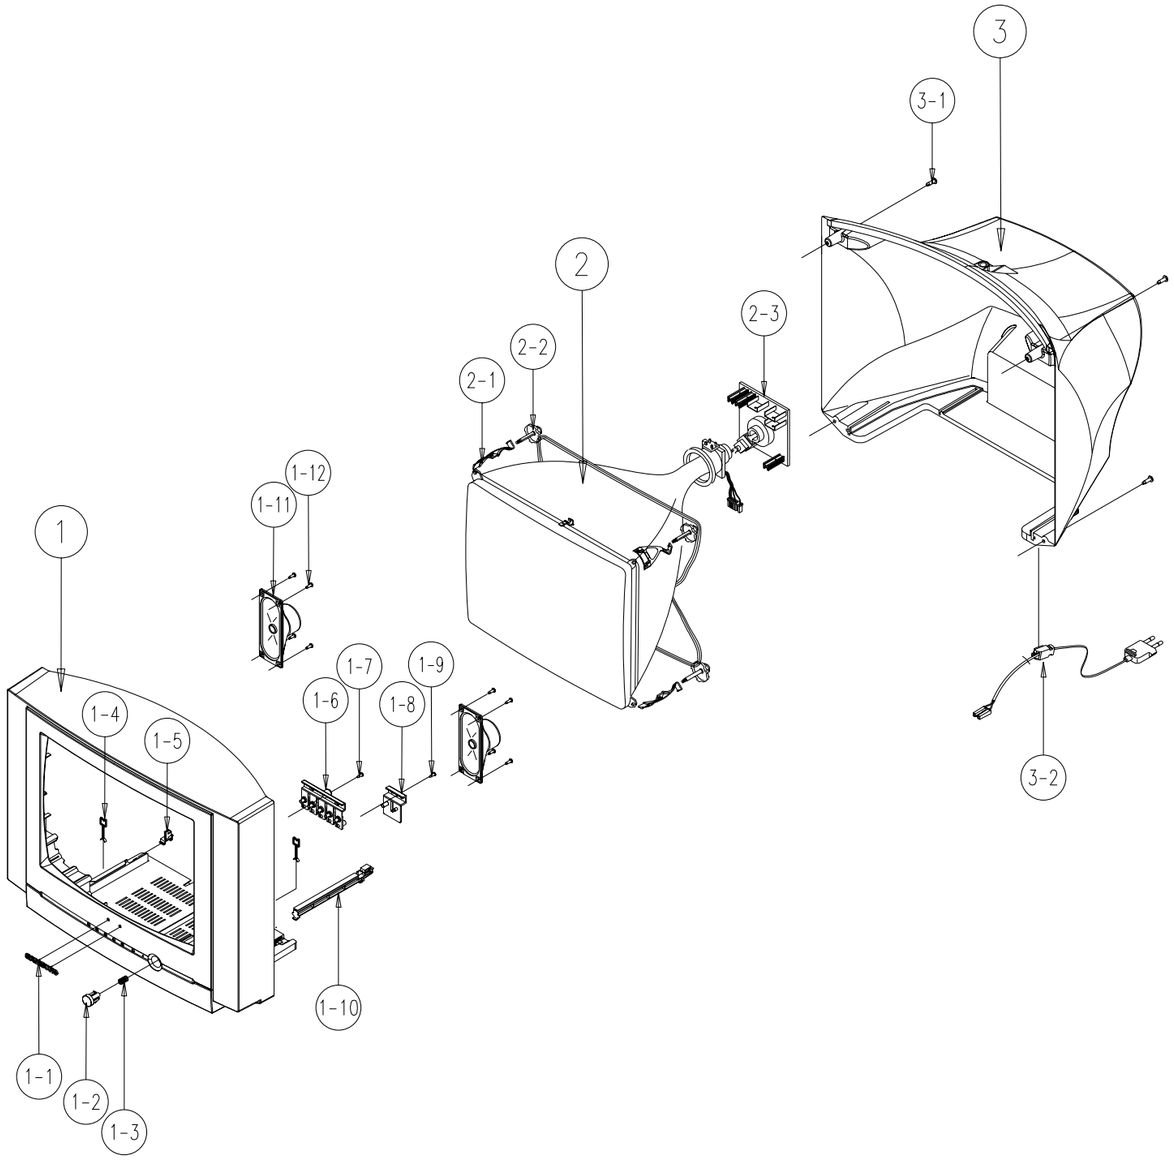

No	Code No	Description	Specification	Q'ty	Remark	S.N.A
1	AA96-01337A	ASSY COVER P-FRONT;14V5(TSE),HB,G4309,(S		1	M0011	
1*	AA64-03115A	CABINET-FRONT;14V5(TSE),HIPS,HB,G4309,SV		1		S.N.A
1-1	AA64-70127F	BADGE-BRAND;NEW,AL,T1.4,6.3,L40,R800,SIL		1	T0057	S.N.A
1-2	AA64-03117A	KNOB-POWER;14V5,ABS,HB,G3676,SVM3012		1	T0023	S.N.A
1-3	AA61-60003J	SPRING ETC-CS;-,SUS304,-,-,OD6,N7,OD6,-,		1	CIS7	S.N.A
1-4	AA65-30105A	CLAMPER CORE-WIRE;ALL MODEL,NYLON 66,V2,		1		S.N.A
1-5	AA61-40113A	STOPPER-PCB;501H,HIPS,-,-,HB,NTR,-		1		S.N.A
1-6	AA64-03116A	KNOB-CONTROL;14V5,ABS,HB,G3676,SVM3012		1	T0022	S.N.A
1-7	6003-001019	SCREW-TAPTITE;RH,+,B,M4,L12,ZPC(BLK),SWR		1	T0081	
1-8	AA64-03118A	WINDOW-RMC,LED;14V5,PC,CLR		1	T0299	S.N.A
1-9	6003-001019	SCREW-TAPTITE;RH,+,B,M4,L12,ZPC(BLK),SWR		1	T0081	
1-10		HOLDER-RAIL				
1-11	AA96-10146C	ASSY SPEAKER;-,8ohm,5W,3001-000274,350/7		1		S.N.A
1-12	6003-001019	SCREW-TAPTITE;RH,+,B,M4,L12,ZPC(BLK),SWR		8	T0081	
2	AA91-02164T	ASSY CPT;A34KQV42X,14,+380MG,BARE		1		S.N.A
2-1	AA65-30106A	CLAMPER CORE-D,COIL;14 INCH,NYLON 66,V2,		2		S.N.A
2-2	AA60-10050R	SCREW-ASSY;-,SWRCH18A,M5,L31.5,HH,+,WC,-		4	SC016	S.N.A
2-3	3704-000103	SOCKET-CRT;10P,22.5,14.3,SN,ISMS01S/BK		1	V999S	
3	AA64-01035C	CABINET BACK;14H2,H4,HIPS,HB,G4309		1	T0015	
3-1	AA60-10050T	SCREW-TAPPING;-,SWRCH18A,M4,L20,RH,+,2S,		4	T0081	S.N.A
3-2	AA96-20109B	ASSY POWER CORD;-,CP2/NO(4.0),H/C250,KKP		1	T0066	S.N.A